

## Tractor upgrade time line and check list

**January 2014 - June 2014**

Faults	Solution	Bulletin number / Kit number	Where to find it
Drive belt failed	New drive modification kit.	15-T2-30 / Kit number 50100062 for all models except the 4wd FR730 engine, the kit number is 50100063	2
Dash board faulty	New board has been released with less functions to improve reliability.	448809300	2
Sticky forward and reverse pedals	Remove and grease pedals	11-T8-25	2
Fuel leaking from the top of the fuel tank	Wrong type of 'O' ring was fitted	14-T3-28	2
Steering bolt has fallen out	Shorter bolt and lock tight being applied	15-T6-19	2
Belts failed and broken the loom for the clutch and the lights	Sub loom has been made for a faster repair.	15-T3-30 / Part number 449883200	2
Reverse pedal fouling the 36" HGM deck	Reverse pedal has been altered	14-08-35	2
Front deck tension cradle	Remove old side tensioner	14-T4-68 / 50100040	2
Bearing house excess noise	Only PTO bearing houses with a 4mm clutch stop bracket.	15-08-37	2
Accessory doesn't work	Accessory wires for the attachments i.e. Scarifier / Chipper	14-T3-27	2
Deck belt falls of in the lower position or the tension lever keeps disengaging.	Shim kit and new tension sleeve.	15-T4-71	3
Cut issue on a 36" / 38" decks	Deck speed up kit	15-T4-73	3
Customer would like a mulching deck.	New 42" mulch kit.	15-T4-74/ Kit number 50100036	3
PGC wire has a round connector and the tractor has a white square connector.	Wire update for PGC and tractor.	14-T3-26 / Kit number 50100050	4
Hard to access PGC belt with the metal guarding	Plastic guard with quick release clips	14-T5-35 / Kit number 50100046	4
Old PGC fitting the new style units and the belt is too short.	Belt size was increased	15-09-14	4
Net switch keeps disengaging	Net maget kit	14-T5-36 / Kit number 50100045	5
Incorrect hex bar or belt fitted	Parts list section 12B.		10
Handbrake stiff	Remove handbrake link and grease	N/A	
Wear on RHS PGC arm	Replace and grease arms	327056200	
	New Drop Link kit	50100090	
Sweeper lift handle has bent or Broken	Replace Handle	327005000	
PTO bearings have failed.	New Bearing house Assembly	408806300	