



SERVICE BULLETIN

14-08-35

DATE: 09\05\2014

MODELS CONCERNED:

MK4 B, C, F & T Series Tractors.
B Series B60-4TRAC, B250-4TRAC, C50, C60, C80, F60-4TRAC, F250-4TRAC, T50, T60 & T80.

CONCERN:

A potential reverse pedal clash when using 36 HGM Deck. XRD Decks are unaffected. Problem exists on models produced between January and middle of May 2014.

The Reverse Pedal

Problem


A potential problem has been identified with the reverse foot pedal and 36 HGM drive pulley safety guard. When the deck lift mechanism is operated the two parts will clash at level 7. This issue will prevent travel beyond level 7 to level 9. It could also cause damage to the deck and reverse pedal.


Solution

A modified pedal assembly has been produced. The new part avoids contact with the deck. This part can be swapped with the existing assembly with minimal rework.

New Part Name	Part Number	Comment
Reverse Pedal Assembly	329650200	Part number unchanged (revised issue)

Identifying the Problem Part

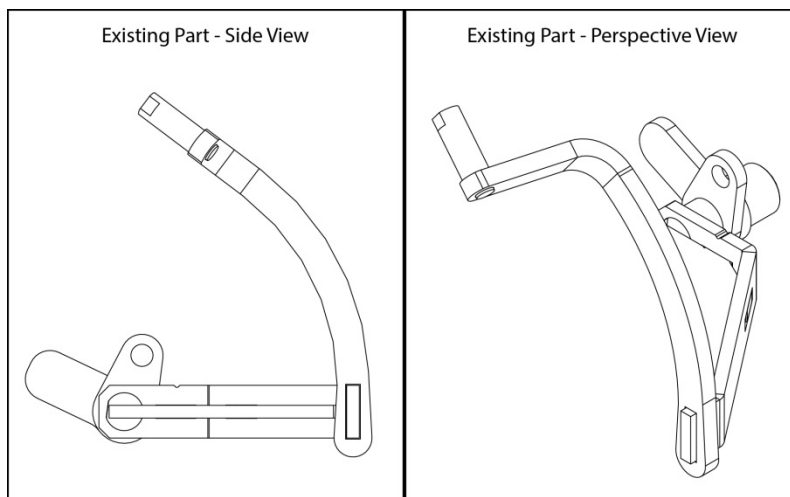

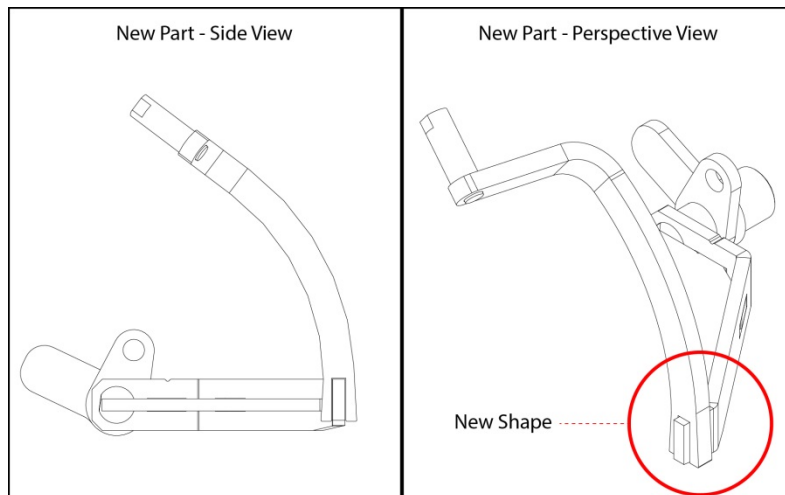

Replacement

Before performing maintenance park tractor on a flat even surface, engage parking brake and remove engine key.

1. Remove fixing components as shown in diagram below.
2. Remove pedal bracket and components as shown in diagram below.
3. Replace obsolete bracket with updated version.
4. Replace fixing components removed in steps 1 and 2.

