



SERVICE BULLETIN

BULLETIN #: 16-08-41 Rev A

DATE: 27/06/2016

MODELS CONCERNED: A25-50HE / V25-50HE / A230D / V230D


USED ON THE FOLLOWING: Serial numbers prior to A0330761

INFORMATION: A series reverse pedal contacting running board rim

A potential issue has been identified that in some circumstances it may be possible for the reverse pedal on the A series tractors to contact the running board rim.

This can slow down the return of the pedals to the neutral position and in extreme cases it has the potential to stop the pedals returning altogether. Please note that it does not lock up the pedals, a simple touch with the foot will allow it to return easily to neutral.

To help prevent this situation occurring a cut-out has been added to the rim as shown in the picture below.

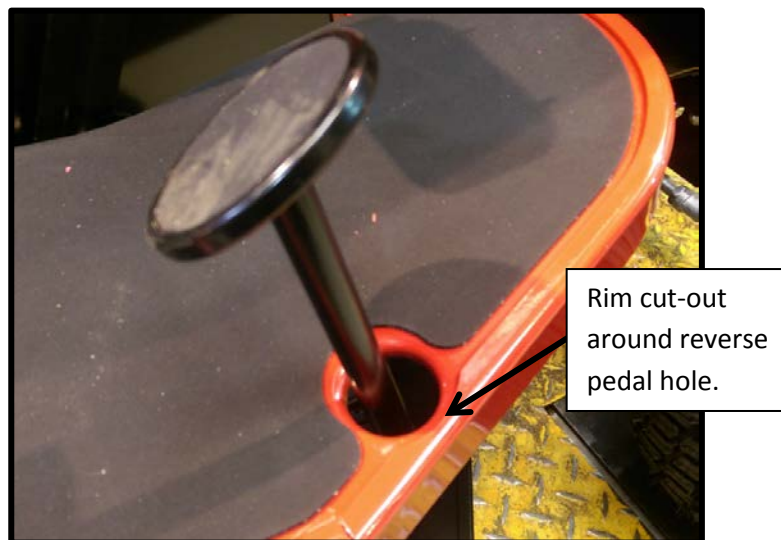

On tractors that don't have this cut-out (prior to serial # A0330761) it is advisable to check if the reverse pedal touches the rim by pressing the forward pedal to its limit. This will cause the reverse pedal to rise up through the running board and if contact is observed then the running board should be changed for one with a cut-out. The part number for the RH running board is:

321122500

Bulletin Revision Log		
No.	Revision Date	Reason / Comments
A	27/06/2016	Initial release.